


MAINTENANCE ALERT – ARMORWIRE CABLE GRIP ASSEMBLIES

APRIL 2020

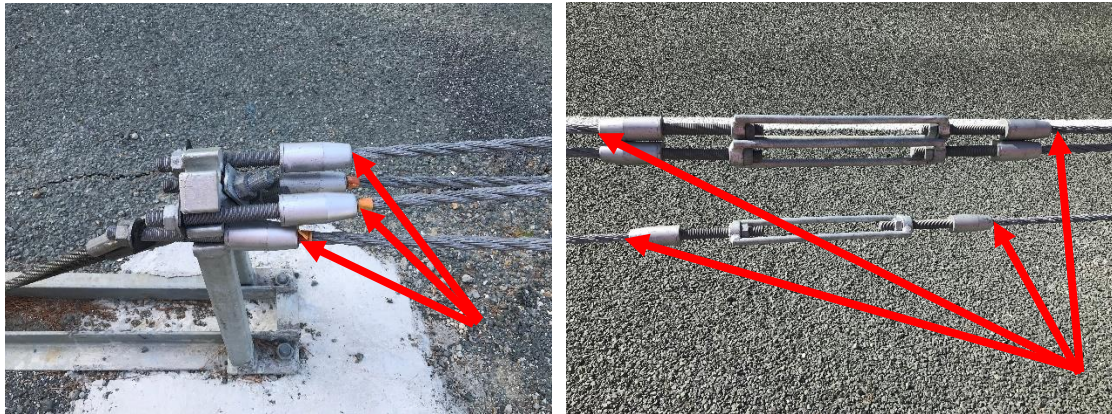

In addition to normal operational maintenance for the Armorwire system (as detailed [here](#)) the following additional maintenance requirement has been identified to address a corrosion issues identified in-service:

ADDITIONAL MAINTENANCE REQUIREMENTS

- Please inspect all cable grip assemblies at both the end terminal and turnbuckle locations for signs of internal corrosion at the point the wire enters the grip assembly as indicated above by the red arrows – ensure ALL grips are inspected
- IF NO CORROSION IS VISIBLE – please spray internally around the sides of the wire entry point, with CRC ANTI-RUST LUBRICANT (or similar)

Details [here](#)



- IF CORROSION IS VISIBLE ON THE WIRE ENTERING THE GRIP – please take a photo of the corrosion and note the location. Then contact CSP Pacific on the details below so we can arrange to send a new cable grip assembly to replace the one identified. The replacement grip assembly and any reasonable additional costs will be covered by CSP Pacific ONLY if pre-approved by email.

CONTACT DETAILS:



[0800 655 200](tel:0800655200)

hello@cspacific.co.nz

CSP
PACIFIC